
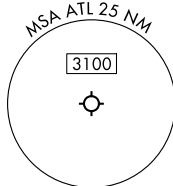



23334

ILS RWY 27L (CAT II)
HARTSFIELD-JACKSON ATLANTA INTL (ATL)

MISSED APPROACH: Climb to 1500 then climbing left turn to 4000 on heading 265° and RMG VORTAC R-165 to DUTIE/RMG 31.3 DME/RADAR and hold.

CLNC DEL 118.1	CPDLC
-----------------------------	-------

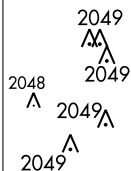

1500 ↑ 		RMG R-165	DUTIE RMG [31.3]	VGSI and ILS glideslope not coincident (VGSI Angle 3.00/TCH 79).				SILVAA I-FSQ [22.5] RADAR
			DEPOT I-FSQ [7.2] RADAR	GRMPI I-FSQ [11.9] RADAR	SEJAY I-FSQ [15.6] RADAR	ROMMM I-FSQ [19.1] RADAR		
								
— 1026' — 5.5 NM — 4.7 NM — 3.8 NM — 3.5 NM —								
CATEGORY	A	B	C	D				
S-ILS ZTL	RA 127/12 100 DA 1099							

CATEGORY II ILS- SPECIAL AIRCREW
& AIRCRAFT CERTIFICATION REQUIRED

ILS RWY 27L (CAT II)

SE-4, 22 FEB 2024 to 21 MAR 2024